


Remove external jacket for 50 mm

Remove external jacket for 155 mm

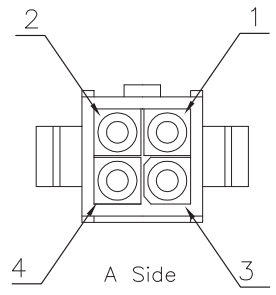

Note (1): Create a new wire using GND wire and a part of external shield insulate with Shrink tube Pos.60

Note (2): Remove completely the external shield and insulate with Shrink tube Pos.70

(A) Motor Side		Cable (4x0,75)Sk PUR	(B) Driver Side	
Section	Pin	Connection diagram	Label	Color wire
0,75	1		U	U/1/L1
0,75	2		V	V/2/L2
0,75	3		W	W/3/L3
0,75	4 (1)		GND	
			(2)	Shield

Pos.	Item.	Description	Q.ty
10	13-EBX19G04P-A1	Nexans - Cable (4G0,75)Sh PUR Orange UL	Length
20	172159-1	Tyco - Connector Mini Mate-N-Lock 4P/F	1
30	173362-1	Tyco - Contact Mini Mate-N-Lock (reel 4000pcs)	4
40		Cembre - Ferrules 0,75mm <sup>2</sup> L=12mm	3
50		Cembre - Ring M4x1,5mm <sup>2</sup>	1
60		Mitron - Shrink Tube D.3,2/1,6 L=50mm	1
70		Mitron - Shrink Tube D.6,4/3,2 L=30mm	2
80		Identification Ring U/V/W	1
90		PEW Label	1
100		PEW Packing Bag	1
110		PEW Leaflet	1